


**An Asbestos Management with part Refurbishment Survey (MA & PA) at**  
**18 Brickham Road**  
**Devizes**  
**Wiltshire**  
**SN10 2SS**

<b>Commissioned By:</b>	Repairs request South Coast (South west) Guinness Partnership The Guinness Partnership 30 Brock Street Regents Place London NW1 3FG	
<b>Survey Conducted:</b>	9 February 2023	
<b>Date of approval:</b>	13 Feb 2023	
<b>Our Reference:</b>	J309168	
<b>Surveyed By:</b>	Fiona Williamson	
<b>UPRN:</b>	11502	
<b>Scope of Works:</b>	Refurbishment survey to the kitchen ceiling prior to leak repairs with a management survey to the remainder of the property.	
<b>Requested By:</b>		

Presented by:  
Clan Works  
1A Howard Road  
Bromley  
Kent  
BR1 3QJ

**t:** 0800 883 0334  
**e:** [asbestosadmin@pennington.org.uk](mailto:asbestosadmin@pennington.org.uk)  
**w:** [www.pennington.org.uk](http://www.pennington.org.uk)

 <p><b>RICS</b> The mark of property professionalism worldwide</p>		 <p><b>ecmk</b></p>		 <p><b>HAS</b> CONTRACTORS HEALTH &amp; SAFETY ASSESSMENT SCHEME</p>		 <p><b>NICEIC</b></p>	
 <p><b>UKAS</b> TESTING 0830</p>	 <p><b>UKAS</b> INSPECTION 0179</p>	 <p><b>GAS safe</b> MEMBER</p>		 <p><b>constructionline</b></p>		 <p>Registered Course Provider <b>British Occupational Hygiene Society</b> Working for a healthier workplace Registered Course Provider</p>	

## Contents

1.0 Executive Summary	3
2.0 General Site and Survey Information	11
3.0 Interpretation of Recommendations / Actions	12
4.0 Actions and Conclusions	13
5.0 UKAS Accreditation	13

## Appendices

Plans	Appendix 1
Asbestos Register	Appendix 2
Asbestos Analysis Report	Appendix 3
Limitations	Appendix 4
Standard Assessment Scores	Appendix 5
Quality Audit	Appendix 6

## 1.0 Executive Summary

### 1.1 Introduction

Pennington Choices Ltd carried out an Asbestos Management with part Refurbishment Survey (MA & PA) at 18 Brickham Road. The survey and this report are in accordance with HSG264 – Asbestos: The Survey Guide.

The scope of works for this survey is as follows:

Refurbishment survey to the kitchen ceiling prior to leak repairs with a management survey to the remainder of the property.

The purpose of the management survey was to locate as far as reasonably practicable, the presence and extent of any ACMs in the areas of the building subject to this survey which could be damaged or disturbed during normal occupancy, including foreseeable maintenance and installation, and to assess their condition.

The purpose of the refurbishment survey was to locate as far as reasonably practicable, the presence and extent of any ACMs in the areas of the building affected by the refurbishment works as described within the scope of works.

This survey report includes Material Assessment (MA) of identified asbestos containing materials and Priority Assessment (PA) for the areas where the asbestos containing materials have been located.

Our surveyor has determined the property type as follows:

Three bedroom house

The estimated building age is:

1980s

The construction type is described as follows:

Brick built house

## 1.2 Summary of Findings

The findings of the survey are summarised in the tables below:

### **Urgent Asbestos Containing Materials (IMMEDIATE ACTION REQUIRED)**

These are identified or presumed asbestos-containing materials that could pose an immediate risk of exposure to individuals.

Location (Plan room references in brackets)	Result (asbestos type)	Action	Sample Ref	Extent
There are currently no urgent items.				

### Other Asbestos Containing Materials

These are identified or presumed asbestos-containing materials, which require action or ongoing management.

Location (Plan room references in brackets)	Result (asbestos type)	Action	Sample Ref	Extent
18 Brickham Road External (014) External Cement board undercloak to roof and entrance canopy	Chrysotile	Manage and Inspect	FW008631	15lm

### Non asbestos items (no asbestos detected in sample)

These are materials which have been identified by sample analysis as non-asbestos, or are visually consistent with non-asbestos sampled materials.

Location (Plan room references in brackets)	Result (asbestos type)	Sample Ref
18 Brickham Road Ground (001) Kitchen Textured coating to plasterboard ceiling	No Asbestos Detected	FW008627
18 Brickham Road Ground (002) Cupboard Textured coating to plasterboard underside to stairs	No asbestos detected in visually consistent material	As FW008628
18 Brickham Road Ground (003) Lounge Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008628
18 Brickham Road Ground (004) Hall Textured coating to plasterboard ceiling	No Asbestos Detected	FW008628
18 Brickham Road Ground (005) WC Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008628
18 Brickham Road First (006) Landing Textured coating to plasterboard ceiling	No Asbestos Detected	FW008629
18 Brickham Road First (007) Bathroom Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008629
18 Brickham Road First (008) Bedroom Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008629
18 Brickham Road First (009) Cupboard Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008629

Location (Plan room references in brackets)	Result (asbestos type)	Sample Ref
18 Brickham Road First (010) Bedroom Textured coating to plasterboard ceiling	No Asbestos Detected	FW008630
18 Brickham Road First (011) Bedroom Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008630
18 Brickham Road First (012) Cupboard Textured coating to plasterboard ceiling	No asbestos detected in visually consistent material	As FW008630

### Areas inspected and found not to contain asbestos materials

These are areas that have been accessed and inspected, in accordance with the scope of works and no asbestos materials have been identified. However, access limitations within these areas may apply and, if so, are detailed in the Asbestos Register.

Location (Plan room references in brackets)
18 Brickham Road Roof Void (013) Loft



### 1.3 No Access Areas

The following is a list of areas which fall within the scope of the survey but were not able to be accessed:

Location	No/Limited Access
None	

Individual areas of limited access will be defined within the rooms notes of the areas where the limitation occurred.

#### 1.4 General limitations

Other parts or components of the building were not accessible or were only accessible on a limited basis, details of which are set out below:

##### General Areas No/Limited Access

Electrical components (fuse boxes, control panels, conduits, other):	Not applicable
Within flues/chimneys:	Not applicable
Pipe gaskets/flue pipe seals/air duct seals/gaiters:	Not applicable
Under non asbestos insulations - pipe, eave:	Not applicable
Under upper roof covering:	Not applicable
Behind or through plaster skimmed material due to decorative damage (due to scope):	Not applicable
Within doors/firedoors (due to scope):	Not applicable
Concealed spaces unknown to the surveyor:	N/A
Known floor and/or wall voids e.g. wall cavities (due to scope):	Not applicable
Above, behind and/or below original decorative features due to listed status:	Not applicable
Within lift shafts:	Not applicable
Behind window frames:	Not applicable
Behind door frames:	Not applicable
Within undercrofts/ sub-floor ducts:	Not applicable
Other:	
N/A	

##### Specific Access Limitations

Please also refer to the Asbestos Register in Appendix 2 for specific access issues.

## **2.0 General Site and Survey Information**

### **2.1 Survey Details**

Key details of the site, client, surveyors, scope of works, survey type and dates of the survey are located on the front cover page of this report.

The survey was conducted in accordance with HSG264 and our UKAS accredited Surveying Quality Manual Technical Procedures and other internal procedures.

### **2.2 Use of this survey report**

This report should be read in full.

The aim of the survey is to provide the client with information in order to be able to comply with the Control of Asbestos Regulations 2012.

This survey report is not a management plan but can be used to assist in devising one.

This survey is not suitable for use prior to any refurbishment or demolition works other than those described within the scope of works in section 1.1 and an appropriate survey should be commissioned prior to undertaking any other works which are likely to disturb the fabric of the building.

Anyone using this document should have a full understanding of the survey scope, the report findings and its limitations. Should any part of this report not be fully understood, advice should be sought from Pennington Choices or a competent third party prior to the undertaking of any works.

All extents detailed within this report are approximations and removal contractors should not rely on these extents for costing purposes. This report is not to be used in isolation as a scope of works for remediation.

The risk ratings used for Priority Risk Assessments are based on the information available to the surveyor at the time of the inspection and it is the duty holders responsibility to check and confirm those findings before inclusion within their asbestos management plan. The duty holder would have to re-calculate these risk scores and re-evaluate the management option for any ACM's affected by building or room use changes.

### **2.3 Third Party Rights**

This report is only for the use of the party to whom it is addressed and no responsibility is accepted to any other party for the whole or any parts of its contents and the Contracts (Rights of Third Parties) Act 1999 shall not apply. Neither the whole, nor a part of this report, or any reference thereto, may be included in any document or statement, nor published or reproduced in any way, without our prior approval in writing as to the form and context in which it will appear.

### 3.0 Definition of Recommended Actions

Recommendations on dealing with asbestos occurrences have been provided and are based on guidance and information contained within HSG264: The Asbestos Survey Guide, Control of Asbestos Regulations 2012, Approved Codes of Practice and the Health and Safety at Work Act 1974. The terminology for these are categorised and explained as follows:

**Manage** – the ACM is found to be in a good to fair condition and is sufficiently sealed or encapsulated. Note that there is no legal requirement to label ACM's although if it is not the duty holders policy to undertake labelling then the ACMs should be managed according to the management plan which the duty holder has in place. Re-inspection of asbestos containing materials should generally be conducted by a competent person on at least an annual basis and for higher risk materials consideration should be given for a more frequent basis.

**Encapsulate** – the ACM has unsealed areas, is completely raw or has parts of the sealant that has delaminated and the material now has the potential to release fibres. The material itself will require encapsulation with a suitable sealant i.e. ET150 elastomeric paint or a physical barrier will need to be installed, dependant on the likelihood that it will be disturbed.

**Remove** – 'Remove' will be the default recommendation for all asbestos items in Refurbishment surveys and Demolition Surveys or in any management survey where the ACM has deteriorated such that encapsulation or enclosing is not a feasible option. Removal of asbestos insulation board (AIB), asbestos insulation and asbestos sprayed coatings will normally require a 14 day notification to the HSE and will need to be undertaken by a licensed contractor.

**Remediate in line with refurbishment scope** – the ACM is located in an area that may be disturbed during the scope of the proposed works. The material should be subject to a risk assessment and remediated accordingly to ensure it is not disturbed during works. If it is deemed that it can be left in situ, the material should be managed as previously detailed.

**Prohibit Access** – the ACM has deteriorated to such an extent that it has become highly damaged and will require immediate action. This is often but not always reported as debris and is susceptible to high levels of disturbance if access is left permitted to the location where it has been identified. Removal of damaged ACM's and decontamination of debris and surrounding areas will then be required if the area requires accessing in the future.

**Use of Licensed Contractors** – Remediation of some ACM's do not require a license although a licensed contractor has the knowledge and experience in adopting the appropriate controls to remove and dispose of the ACM safely therefore this approach is used in our recommendations. For further guidance on which asbestos-containing materials do require a licensed contractor, please contact Pennington Choices Ltd or the HSE.

Recommendations detailed within the asbestos register are based upon the surveyors on assessments and interpretations made at the time of the survey.

#### 4.0 Actions and Conclusions

Please refer to the tables in the Summary of Findings section within the Executive Summary (Section 1.0).

Where asbestos containing materials have been identified, specific actions have been detailed and these are fully explained in Section 3.0. Detailed information, general notes, photographs and scoring are all to be found in the Asbestos Register in Appendix 2.

If no asbestos items have been positively identified in this survey, it should still be presumed that any 'No Access' or 'Limited Access' areas or components do contain asbestos until further inspection has been carried out.

The prioritisation of actions is the responsibility of the duty holder. If Priority Assessments have not already been completed, further information on how to conduct these can be found in HSG 227 - A Comprehensive Guide to Managing Asbestos in Premises.

#### 5.0 UKAS Accreditation

Pennington Choices Ltd is a UKAS (United Kingdom Accreditation Service) accredited laboratory. Strict controls on inspection bodies and laboratories are laid out and monitored by UKAS.

##### Testing

Pennington Choices Ltd meets the requirements of ISO 17025 for bulk sampling, bulk identification and air sampling and holds the UKAS accreditation number 0630 for testing.

##### Inspections

Pennington Choices Ltd is accredited as a Type 'C' inspection body meeting the requirements of ISO 17020 and holds the UKAS accreditation number 0179 for asbestos surveys.

##### Priority Assessment Scores

Pennington Choices Ltd is accredited for priority assessment scoring where applicable. This is a support service, conducted following consultation with the duty holder and the ultimate responsibility for the management of asbestos within the premises lies with the duty holder

## Appendix 1

### Plans

*The plans, while not to scale, provide you with an overview of the layout of the building and will help you to locate any asbestos containing materials that are referenced in the Asbestos Register (Appendix 2). Each room is provided a unique number. Each sample that we have taken also has a unique number. Both cross reference to the Asbestos Register. The plan is marked to show the areas or rooms where asbestos containing materials have been found. The 'Key' which follows this page provides further help in understanding the plans.*

---


**Key for Plans showing Asbestos Locations**




Asbestos identified or presumed or in this room. Refer to Asbestos Register (Appendix 2) for details



Area not accessed



Sample number



Reference sample number

**(001)**

Area Numbering




Presumed Asbestos



PENNINGTON  
CHOICES

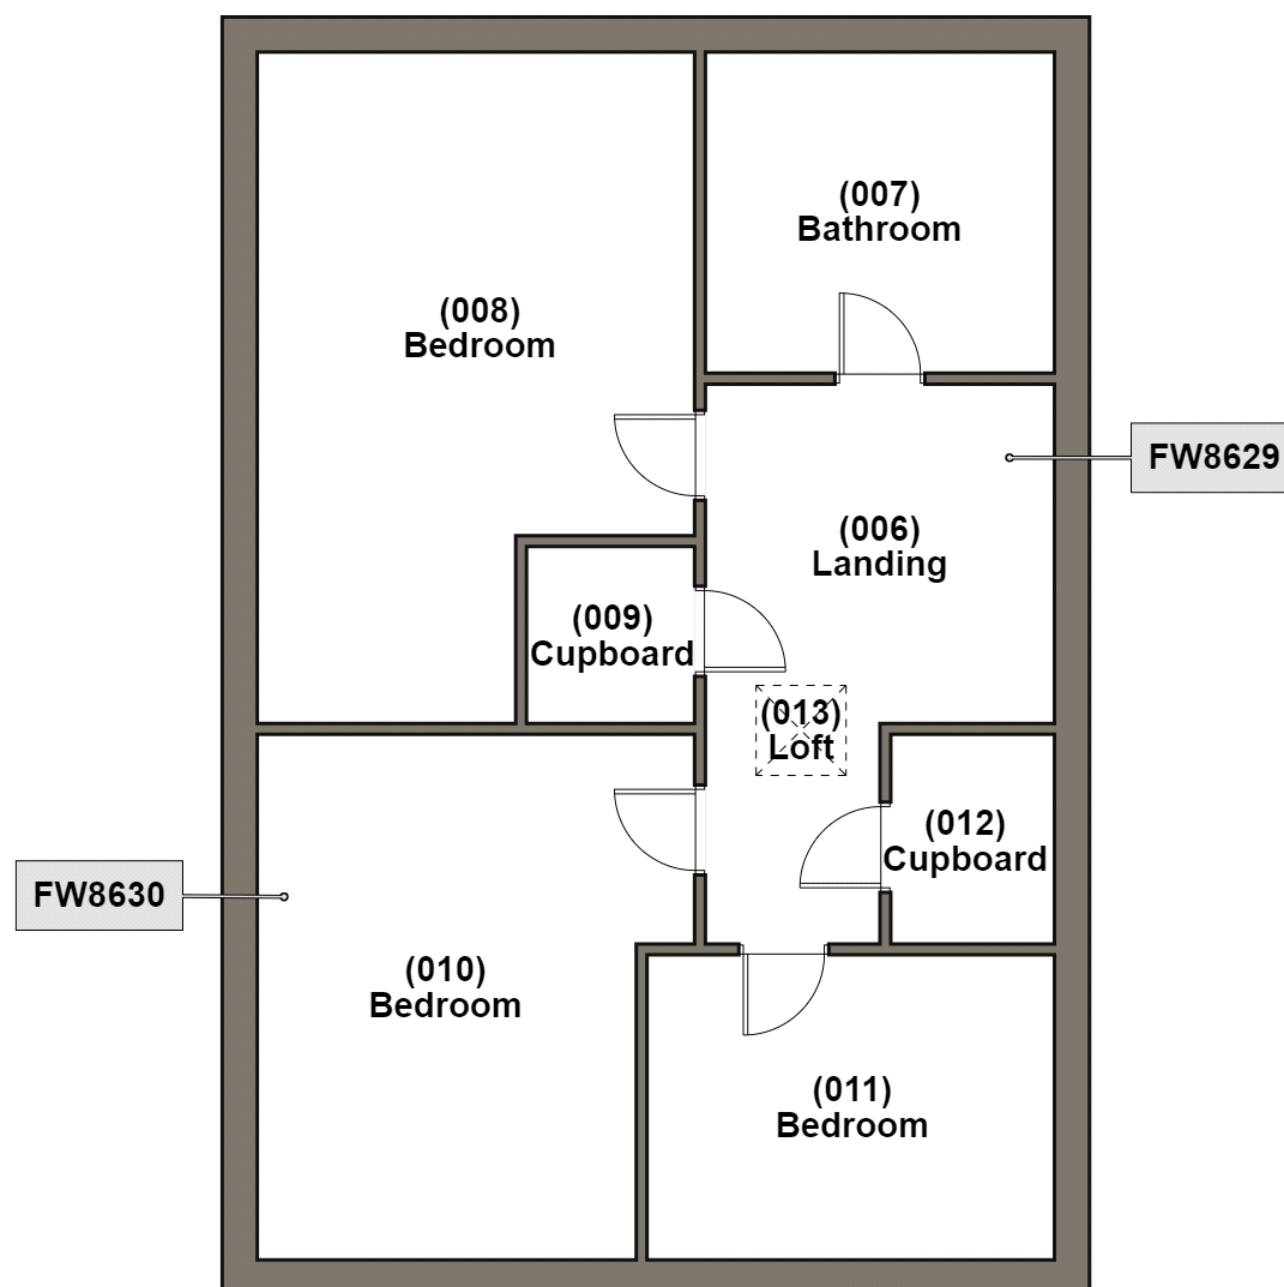

[illegible]

## Appendix 2

### Asbestos Register

*The sheets that follow this page constitute the Asbestos Register. Each room or area referenced in the plan (Appendix 1) has a sheet. Where no suspected asbestos was found under the scope of this survey this is recorded, together with general notes detailing stand-out items noted in the area in question e.g. MMMF pipe lagging present. Where asbestos has been identified, is presumed or is referenced to a sample this is recorded with the assessment and recommended actions.*

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 1 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Ground	<b>Item Ref:</b>	<b>J309168-1</b>
<b>Room Name:</b>	(001) Kitchen				
<b>Sample Ref:</b>	FW008627				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	18m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No Asbestos Detected		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling (behind layer of plaster). Hardboard ceiling above plasterboard ceiling. Metal pipes running in void area above plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to floor - no access under laminate panelling (excessive damage). Wooden and plasterboard boxing adjacent to radiator - no access within boxing (excessive damage). No sink pad. uPVC windows and ceramic tile and uPVC over wooden sills. Wooden door to garden. Modern Vaillant boiler with plastic flue. Wooden panelling over metal pipework below and to the side of the boiler. Modern extract fan in wall. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 2 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Ground	<b>Item Ref:</b>	<b>J309168-2</b>
<b>Room Name:</b>	(002) Cupboard				
<b>Sample Ref:</b>	As FW008628				
<b>Component:</b>	Textured coating to plasterboard underside to stairs				
<b>Extent:</b>	3m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		


<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard underside to stairs. Plaster to brick and plasterboard walls. Carpet to concrete floor. Modern electrics on wall.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 3 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Ground	<b>Item Ref:</b>	<b>J309168-3</b>
<b>Room Name:</b>	(003) Lounge				
<b>Sample Ref:</b>	As FW008628				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	20m <sup>2</sup>				

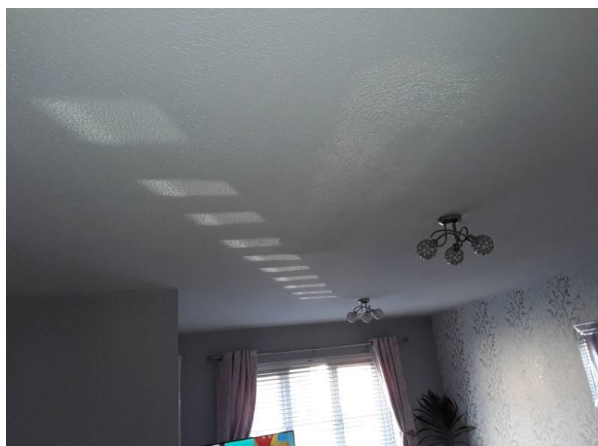

Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to floor - no access under laminate panelling (excessive damage). uPVC window and uPVC over wooden sill. Modern radiator. Modern electric heater.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 4 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Ground	<b>Item Ref:</b>	<b>J309168-4</b>
<b>Room Name:</b>	(004) Hall				
<b>Sample Ref:</b>	FW008628				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	3m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No Asbestos Detected		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to floor - no access under laminate panelling (excessive damage). Carpet to wooden stairs. Wooden front door. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 5 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Ground	<b>Item Ref:</b>	<b>J309168-5</b>
<b>Room Name:</b>	(005) WC				
<b>Sample Ref:</b>	As FW008628				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	2.5m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to floor - no access under laminate panelling (excessive damage). Plasterboard boxing adjacent to toilet - no access within boxing (excessive damage). Wooden boxing under sink - no access within boxing (excessive damage). Ceramic cistern. uPVC window and wooden sill. Modern extract fan in wall. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 6 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-6</b>
<b>Room Name:</b>	(006) Landing				
<b>Sample Ref:</b>	FW008629				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	7m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No Asbestos Detected		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>		
--------------------------------------------	--	--


Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Carpet to hardboard floor and wooden stairs. uPVC window and wooden sill. Plastic loft hatch access panel.	



# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 7 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-7</b>
<b>Room Name:</b>	(007) Bathroom				
<b>Sample Ref:</b>	As FW008629				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	6m <sup>2</sup>				

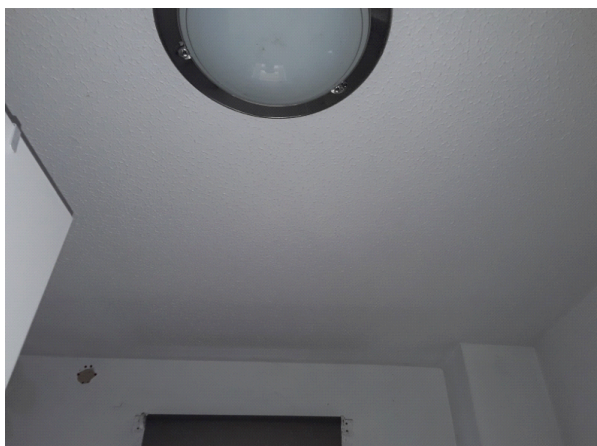

Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		


<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Modern linoleum to hardboard floor. Plasterboard boxing adjacent to toilet - no access within boxing (excessive damage). No bath panel. Plastic and metal pipes in void area under bath. Ceramic cistern. uPVC window and ceramic tile sill. Modern extract fan in wall. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 8 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-8</b>
<b>Room Name:</b>	(008) Bedroom				
<b>Sample Ref:</b>	As FW008629				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	12m <sup>2</sup>				

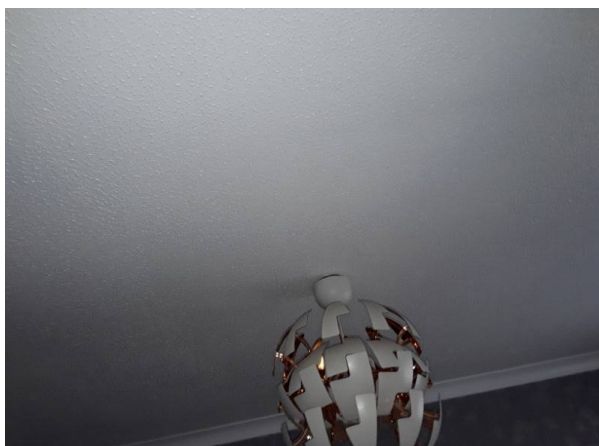

Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to hardboard floor. uPVC window and wooden sill. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 9 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-9</b>
<b>Room Name:</b>	(009) Cupboard				
<b>Sample Ref:</b>	As FW008629				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	1.5m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plasterboard walls. Hardboard floor. Modern immersion heater.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 10 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-10</b>
<b>Room Name:</b>	(010) Bedroom				
<b>Sample Ref:</b>	FW008630				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	12m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No Asbestos Detected		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Laminate panelling to hardboard floor. uPVC window and wooden sill. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 11 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-11</b>
<b>Room Name:</b>	(011) Bedroom				
<b>Sample Ref:</b>	As FW008630				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	8m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Carpet to hardboard floor. uPVC window and wooden sill. Modern radiator.	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 12 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	First	<b>Item Ref:</b>	<b>J309168-12</b>
<b>Room Name:</b>	(012) Cupboard				
<b>Sample Ref:</b>	As FW008630				
<b>Component:</b>	Textured coating to plasterboard ceiling				
<b>Extent:</b>	2m <sup>2</sup>				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No asbestos detected in visually consistent material		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Textured coating to plasterboard ceiling. Plaster to brick and plasterboard walls. Hardboard floor	

# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 13 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	Roof Void	<b>Item Ref:</b>	J309168-15
<b>Room Name:</b>	(013) Loft				
<b>Sample Ref:</b>					
<b>Component:</b>	No asbestos containing materials found				
<b>Extent:</b>					



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	
No suspect materials		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
<b>Priority Assessment Score (PA)</b>		

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	
--------------------------------------------	--

Conclusions and Actions	
<b>Recommendation:</b>	No further action required
<b>Further Information:</b>	None
<b>General Notes:</b> Limited access due to tenants belongings. Modern sarking felt. Breeze block walls. Plasterboard floor panels. MMMF insulation. Plastic loft hatch access panel.	



# Asbestos Register

Site Address: 18 Brickham Road, Devizes, Wiltshire	Ref No. J309168	Date Of Issue 13/02/2023
	Page 14 of 15	

<b>Building:</b>	18 Brickham Road	<b>Floor Level:</b>	External	<b>Item Ref:</b>	<b>J309168-17</b>
<b>Room Name:</b>	(014) External				
<b>Sample Ref:</b>	FW008631				
<b>Component:</b>	Cement board undercloak to roof and entrance canopy				
<b>Extent:</b>	15lm				



Material Assessment		
<b>Product Type</b>	<b>Extent of damage</b>	<b>Surface Treatment Score</b>
Cement (1)	Low Damage (1)	1
<b>Asbestos Type</b>	<b>Material Assessment Score (MA)</b>	<b>Very Low (4)</b>
Chrysotile (1)		

Priority Assessment		
<b>Occupant Activity</b>	<b>Location Score</b>	<b>Accessibility Score</b>
0 (Rare disturbance)	0	0
<b>Extent Score</b>	<b>No. of occupants</b>	<b>Frequency of Use</b>
2 (10m^2 - 50m^2 or 10m - 50m pipe run)	2 (4 to 10)	3 (Daily)
<b>Avg. time area is in use</b>	<b>Type of Maintenance</b>	<b>Freq. of Maintenance</b>
0 (<1 hour)	0 (Minor disturbance)	1 (<1 per year)
<b>Priority Assessment Score (PA)</b>		<b>4</b>

<b>RISK ASSESSMENT TOTAL SCORE (MA+PA)</b>	<b>8</b>
--------------------------------------------	----------

Conclusions and Actions	
<b>Recommendation:</b>	Manage and Inspect
<b>Further Information:</b>	None
<b>General Notes:</b> Modern roof tiles. Wooden soffits and fascia. Plastic drainpipes and guttering. Cement board undercloak to roof and entrance canopy. uPVC windows. Wooden front and rear doors. Modern roof tiles and sarking felt to entrance canopy. Modern damp proof course.	



This register should only be seen as an overview of the current situation within the areas surveyed. A refurbishment or demolition survey should be undertaken prior to any refurbishment or demolition. The survey was a management survey (HSG264), destructive surveying techniques were outside the scope of the survey and further investigation of suspicious materials should be undertaken if discovered.

#### **Material Assessment (HSG264, 2012)**

Description refers to materials potential to release asbestos fibres

Where visually consistent material is referenced to an analysed 'No Asbestos Found' sample, this is a visual assessment only. Therefore, further sampling must be requested if further confirmation is required.

This register is not complete without being accompanied by the full report. All written components must be read prior to making any assessments based upon the surveyors' findings. All positive incidents of asbestos are recommended to be labelled if to be left in place and not removed during refurbishment works.

Please note the Priority Assessment scores for each item have been determined via consultation with the duty holder or their representative. Where the duty holder or their representative is not available then the standard scoring template has been utilised as per appendix 6 of this report.

The recommendations within the conclusions and actions section of the asbestos register are based upon the surveyors own observations made at the time of survey

#### **Management and remedial actions**

**HIGH RISK (A) 19 Points or more with Priority Assessment, 10 points or more with only the Material Assessment.**

This is the highest level category and warrants urgent action because the asbestos is likely to be damaged, friable and may be in a position likely to cause an exposure to occupiers. In most cases it will be necessary to prevent access or occupation with immediate effect. If access to the area is required in the future, then plans should be made for remediation. This category will normally require removal of the asbestos item, however, under certain circumstances - encapsulation or repair may be possible.

**MEDIUM RISK (B) 13-18 Points with Priority Assessment, 7-9 points with only the Material Assessment.**

This category indicates that there is a potential for asbestos fibre-release to occupiers. Remediation of the asbestos item will normally be required, such as encapsulation or repair. In some cases it may be necessary to prevent access or occupation. Following remediation measures, normal management procedures should be adopted.

**LOW RISK (C) 9-12 Points with Priority Assessment, 5-6 points with only the Material Assessment.**

This category indicates that there is a low risk from the material or/and there is a low possibility of accessing the asbestos. Normal management procedures should be adopted.

**VERY LOW RISK (D) 1-8 Points with Priority Assessment, 1-4 points with only the Material Assessment.**

This category indicates that there is a very low risk from the asbestos. Normal management procedures should still be adopted.

**NO RISK (N/A) 0 points**

No action necessary - the item is not asbestos.

## **Appendix 3**

### **Asbestos Analysis Report J309168**

*The pages in this appendix contain the laboratory analysis reports of any samples that were taken during the course of this survey. It is a requirement of HSG264 that this certificate is included in the report.*

## Asbestos Analysis Report

<b>Report No :</b>	J309168	<b>Sample Batch</b>	1-5
<b>Client :</b>	Guinness Partnership	<b>Client Ref:</b>	5324350/1
<b>Location :</b>	18 Brickham Road, Devizes, Wiltshire, SN10 2SS		
<b>Samples received :</b>	9 February 2023	<b>Report Issued:</b>	13 February 2023
<b>Samples taken by:</b>	Fiona Williamson		

Sample No.	Source	Result	Material (see Note (3))
FW008627	<b>Ground (001) Kitchen Textured coating to plasterboard ceiling</b>	No Asbestos Detected	Textured Coating
FW008628	<b>Ground (004) Hall Textured coating to plasterboard ceiling</b>	No Asbestos Detected	Textured Coating
FW008629	<b>First (006) Landing Textured coating to plasterboard ceiling</b>	No Asbestos Detected	Textured Coating
FW008630	<b>First (010) Bedroom Textured coating to plasterboard ceiling</b>	No Asbestos Detected	Textured Coating
FW008631	<b>External (014) External Cement board undercloak to roof and entrance canopy</b>	Chrysotile	Cement

---

**Test Method:** Polarised light microscopy; Dispersion staining, in accordance with HSG248

---

**Note (1):** PC laboratory analysis of samples and sampling procedures are in compliance with ISO 17025 and our UKAS accreditation.

**Note (2):** Where PC staff have not taken samples, results given are based on information supplied by the client taking the samples. PC is not responsible for any errors/misinterpretations of analytical results due to inappropriate sampling strategies or techniques.

**Note (3):** Observations and interpretations expressed (i.e. nature of fibres other than asbestos or description of material) are outside the scope of our UKAS accreditation.

**Note (4):** This report cannot be reproduced except in full without prior authorisation from the laboratory

---

Types of Asbestos
Amosite - Brown Asbestos
Chrysotile - White Asbestos
Crocidolite - Blue Asbestos

**ANALYST:**



---

Esther Akor

## **Appendix 4**

### **Limitations**

## Limitations

All reasonable efforts were made during the survey to identify and establish the presence of asbestos containing materials and their locations. However, asbestos may be concealed within the structural fabric of a building, which only major refurbishment or full demolition will bring to light, therefore PC cannot guarantee that all asbestos materials have been identified and survey results are definitive. A competent person present at specific points of the demolition process to perform a 'watching brief' may help identify any further asbestos containing materials.

It should be assumed that all electrical installations contain asbestos components unless the equipment was inspected during the survey and none was found. If work that will disturb the electrical installations is to be carried out, it would be prudent to isolate the supply and a competent person investigate the equipment when safe.

Any areas outside the scope of this survey or inaccessible at the time of the survey should be assumed to contain asbestos-containing materials until proven otherwise by a competent person.

Where non-asbestos insulation materials are present to pipework and plant, due to hot surfaces and the potential spread of contamination, it is not deemed practicable to fully inspect pipe surfaces for residual asbestos insulations.

Unless agreed in advance of the survey, no access has been gained beyond materials suspected to contain asbestos at the time of the survey. Such access may require additional control measures which fall outside the scope of this survey.

Unless arranged with the client, the accessing of voids or high level areas (above 2.5 meters) which would require the use of specially trained personnel or access equipment would not have been undertaken. These areas should therefore be presumed to contain asbestos until access arrangements can be made.

Unless full unhindered access has been made available to all areas within the survey scope, limitations would have to be applied. Where necessary, details of these are provided in the survey notes of appendix 2 (asbestos register).

Random dust and debris sampling or sampling to confirm contamination from previous poor asbestos removals have not been carried out unless specifically instructed by the client. As per company policy, dust and debris sampling is only undertaken where there is a known and evident source.

This survey does not constitute a contaminated land investigation to the surrounding areas of the buildings within the survey scope.

No responsibility can be accepted by Pennington Choices for the non-systemic or ad-hoc use of asbestos or the presence of asbestos in stored or portable items.

Where samples have been taken of textured coatings, the identification of materials beneath is restricted to the specific sample point locations. Due to the unlikelihood of ACM's to be present in paint and plaster, the sampling of these materials have not been undertaken unless specifically requested by the client.

## Appendix 5

### Standard Assessment Scores

*In the absence of duty holder information to complete priority risk assessments, the standard scores listed here will be utilised.*

Sample Variable	Score	Example of scores
Product type (or debris from product)	1	Asbestos reinforced composites (plastics, resins, mastics, roofing felts, vinyl floor tiles, semi-rigid paints or decorative finishes, asbestos cement etc.)
	2	Asbestos insulating board, mill boards, other low density insulation boards, asbestos textiles, gaskets, ropes and woven textiles, asbestos paper and felt
	3	Thermal insulation (e.g. pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing
Extent of damage/deterioration	0	Good condition: no visible damage
	1	Low damage: a few scratches or surface marks; broken edges on boards, tiles etc.
	2	Medium damage: significant breakage of materials or several small areas where material has been damaged revealing loose asbestos fibres
	3	High damage or delamination of materials, sprays and thermal insulation. Visible asbestos debris
Surface treatment	0	Composite materials containing asbestos: reinforced plastics, resins, vinyl tiles
	1	Enclosed sprays and lagging, asbestos insulating board (with exposed face painted or encapsulated), asbestos cement sheets etc.
	2	Unsealed asbestos insulating board, or encapsulated lagging and sprays
	3	Unsealed laggings and sprays
Asbestos type	1	Chrysotile
	2	Amphibole asbestos excluding crocidolite
	3	Crocidolite
Total Score		Sum of the above scores



Assessment factor	Score	Example of scores
<b>Normal occupant activity</b>		
Main type of activity in area	0	Rare disturbance (e.g. little used store room)
	1	Low disturbance (e.g. office type activity)
	2	Periodic disturbance (e.g. industrial or vehicular activity which may contact ASM's)
	3	High levels of disturbance (e.g. fire door with asbestos insulating board sheet in constant use)
Secondary activities for area	As above	As above
<b>Likelihood of disturbance</b>		
Location	0	Outdoors
	1	Large rooms or well-ventilated areas
	2	Rooms up to 100m <sup>2</sup>
	3	Confined spaces
Accessibility	0	Usually inaccessible or unlikely to be disturbed
	1	Occasionally likely to be disturbed
	2	Easily disturbed
	3	Routinely disturbed
Extent/amount	0	Small amounts or items (e.g. strings, gaskets)
	1	<10m <sup>2</sup> or <10m pipe run
	2	>10m <sup>2</sup> to <50m <sup>2</sup> or >10m to <50m pipe run
	3	>50m <sup>2</sup> or >50m pipe run

Assessment factor	Score	Example of scores
<b>Human exposure potential</b>		
Number of occupants	0 1 2 3	None 1 to 3 4 to 10 >10
Frequency of use of areas	0 1 2 3	Infrequent Monthly Weekly Daily
Average time area is in use	0 1 2 3	<1 hour >1 to <3 hours >3 to <6 hours >6 hours
<b>Maintenance activity</b>		
Type of maintenance activity	0 1 2 3	Minor disturbance (e.g. possibility of contact when gaining access) Low disturbance (e.g. changing light bulbs in asbestos insulating board ceiling tiles to access a valve) Medium disturbance (e.g. lifting one or two asbestos insulating board ceiling tiles to access a valve) High levels of disturbance (e.g. removing a number of asbestos insulating board ceiling tiles to replace a valve or for cabling works)
Frequency of maintenance activity	0 1 2 3	ACM unlikely to be disturbed for maintenance <1 per year >1 per year >1 per month

## Appendix 6

### Quality Audit

*Prior to this report being issued it will have been reviewed by a number of people as part of our documented quality management systems. The following page confirms that this was undertaken and by whom.*

---

**Report Number J309168**

**18 Brickham Road  
Devizes  
Wiltshire  
SN10 2SS**

Report Author: Rebecca Reilly

Report Writer QA Administrator



Date: 13 February 2023

Report Reviewer: Rebecca Reilly


Report Writer QA Administrator



Date: 13 February 2023

Lead Surveyor: Fiona Williamson

Asbestos Surveyor



Date: 13 February 2023

**This survey was carried out in accordance with our UKAS accreditation and ISO 17020.**